


REPAIR SCOPE A, TO BE RESTORED BUT NOT SCHEDULED



NOTE: THE SCOPE OF THE WORK INCLUDES REMOVAL OF ALL PAINT ON ALL SURFACES WITHIN WORK AREAS & ITEMS REQUIRING WORK. THIS INCLUDES BUT IS NOT LIMITED TO ALL WOODWORK FROM THE ROOF EAVE UP, INCLUDING THE TIN SIDING AT THE BASE OF THE CUPOLA. REFER TO ALL WORK SCOPE DRAWINGS FOR SPECIFIC REQUIRED WORK ITEMS - IN AN EFFORT TO LIMIT LEAD-CONTAINING DUST, WHERE PAINT REQUIRES REMOVAL, STRIP USING ONLY CHEMICAL STRIPPER METHODS, OR REMOVE ITEM OFF-SITE FOR RESTORATION AND PAINT REMOVAL BY ACCEPTABLE MEANS, IT IS NOT ACCEPTABLE TO REMOVE PAINT USING MECHANICAL METHODS ON-SITE DUE TO THE CONCERN FOR AIRBORNE LEAD.

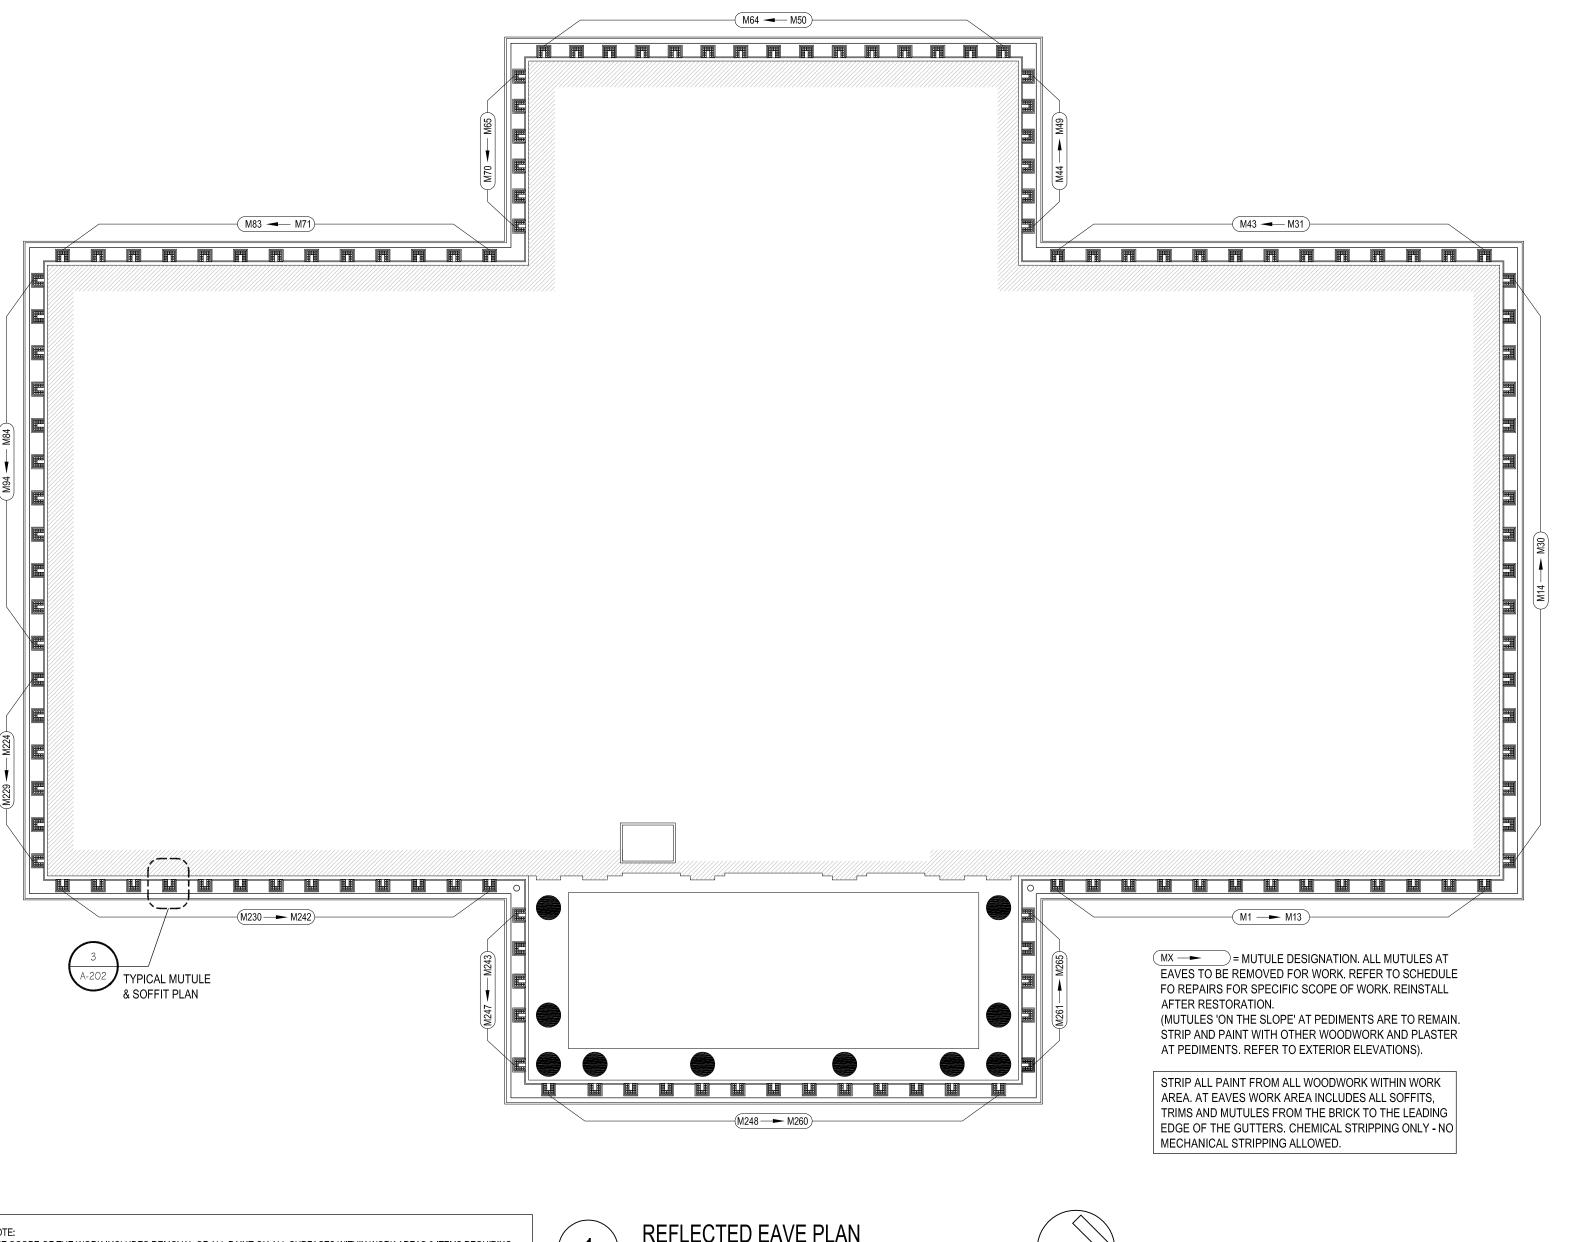

							_		
SC		_	REPAIRS OR QUANTITIES AND LO		UTULES OF MUTULES.	REPAIR SCOPE: A. IF MUTULE IS NOT SCHEDULED FOR REPAIRS IN SCHEDULE, PERFORM THE FOLLOWING WORK TO THE MUTULE: • STRIP ALL PAINT DOWN TO SOLID WOOD.	SCOPE NOTES: 1. REPLACE MISSING GUTTA(E). QUANTITY PER MUTULE IS SHOWN AFTER NOTE IN (X) PARENTHESES		
MUTULE #	SCOPE NOTES	MUTULE #	SCOPE NOTES	MUTULE #	SCOPE NOTES	REMOVE GUTTAE & OTHER FASTENENRS AND REPLACE WITH STAINLESS STEEL WOOD SCREWS RESET & TIGHTEN ALL JOINTS	2.	PROVIDE MINOR SURFACE CONSOLIDATION REPAIR TO MUTULE AND MUTULE TRIM	
M5	2	M57	2, 4	M90	1:(1), 2	PRIME (INCLUDING BACK PRIME), PAINT ALL SURFACES.		COMPONENTS.	
M6	2	M58	2	M91	2	• REINSTALL.	3.	PROVIDE MAJOR CONSOLIDATION	
M7	2	M59	2	M93	2, 4			REPAIR TO FRAME, TRIMS AND	
M36	2	M60	1:(1), 2	M94	2	B. IF MUTULE IS SCHEDULED FOR REPAIRS IN SCHEDULE:		GUTTAE.	
M37	2	M61	2, 4	M227	4	HISTORIC WOOD RESTORATION: SEE SCOPE NOTES FOR	4.	RE-SECURE AND REASSEMBLE	
M38	2	M67	1:(1), 2	M229	4	SPECIFIC SCOPE. REPLACE MISSING COMPONENTS. STRIP		EVIDENT LOOSE AND SEPARATING	
M39	3	M68	3	M232	3, 4	ALL PAINT DOWN TO SOLID WOOD. RESTORE MUTULE BY	_	COMPONENTS.	
M40	2	M74	5	M235	3, 4	CONSOLIDATION - REMOVE DETERIORATED WOOD DOWN TO	5.	REPAIR NICK IN FACE OF FRAME	
M41	3	M75	1, 2	M239	3, 4	SOLID SURFACE. REPAIR DETERIORATED COMPONENTS - PATCH & REPAIR DECAYED WOOD W/ EPOXY CONSOLIDANT	OEE	WITH EPOXY FILLER. E PHOTOS DRAWING 4/A-202 FOR	
M54	2, 4	M76	4	M244	2	REPAIR COMPOUND. RE-ASSEMBLE SEPARATING	SEE	REPRESENTATIVE SCOPE.	
M56	2, 4	M89	2	M254	1:(1)	COMPONENTS. PRIME (INCLUDING BACK PRIME), PAINT ALL		REPRESENTATIVE SOOF E.	
						SURFACES AND REINSTALL.			

					© 2012 TECTON ARC	HITECTS INC.	
seals	drawing ti	CTED E	TAVE PLAN, DETAILS	STATE OF CONNECTICUT OFFICE OF LEGISLATIVE MANAGEMENT			
	mark	date	description	PLANS PREPARED BY	1	date 04/13/12	
				ONE HARTFORD SQUARE WEST	onArchitects inc	scale AS NOTED	
					project CONNECTICUT'S OLD STATE HOUSE	drawn by MF	
					ROOF REPLACEMENT & FACADE RENOVATIONS 800 MAIN STREET HARTFORD, CT 06106	approved SM	
					TIAKTI OND, OT 00100	drawing no.	
	CAD no.				project no. CT-7301	A-202	

SCOPE NOTE REPAIR TYPE 4 —

REPRESENTATIVE PHOTOS OF MUTULES

SCALE: NONE